

PBM-200-A | PBM-200-A10**Installation Instructions**

PBM-200-A | PBM-200-A10 Power entry kit
for up to 3 trace heaters
for use with BARTEC PSB, MSB or HSB trace heaters

Consignes d'installation

Kit de connexion PBM-200-A | PBM-200-A10
pour jusqu'à 3 câbles chauffants
de type BARTEC PSB, MSB ou HSB

Table of contents

| | |
|------------------------------------|-----------|
| Safety | 2 |
| Overview | 3 |
| Compatibility | 3 |
| Certifications / Approvals | 3 |
| Technical data | 3 |
| Trace heater specifications | 4 |
| Kit contents | 5 |
| Accessories | 6 |
| End termination | 7 |
| Spare parts | 7 |
| Installation | 9 |
| Required tools / equipment | 9 |
| Cautions and warnings | 9 |
| Unrolling the trace heater | 9 |
| Installation on pipes | 10 |
| Fastening | 10 |
| Installation of the mounting stand | 17 |
| Cable connection | 19 |
| Wiring | 22 |
| Installation of the end seal | 23 |
| Application of the pipe insulation | 24 |
| Troubleshooting | 25 |
| Limited Product warranty | 26 |

Safety

For safe installation of the PBM-200-A | PBM-200-A10 Power entry kit the technical requirements and instructions given in this manual must be followed.

 WARNING

Risk of fire or electrical shock. Follow these guidelines to avoid personal injury or material damage.

- All electrical systems and installations must comply with BARTEC GmbH requirements and be installed in accordance with the relevant electrical codes and any other applicable national and local codes.
- BARTEC GmbH, the US and Canadian electrical codes require ground fault protection to be provided for all trace heating circuits.
- Note that the design guide that comes with each trace heater contains further important information and must be followed in addition to this manual.
- Install the connection kit, trace heaters and end seals carefully.
- Use the trace heater in accordance with the intended purpose and strictly comply with the operational data specified in section *Technical Data*.
- The bending radius of the trace heater must be at least 1" / 25 mm. Do not bend on the narrow axis.
- Any defective component of the kit must be replaced before installation.
- To avoid short circuits, do not connect the trace heater bus wires together.
- Keep all components and the trace heaters dry before and during installation.
- This kit contains silicone adhesive. Keep out of reach of children. Store at below 77 °F (25 °C). Follow the safety instructions given on the packaging.
- Keep these instructions for future reference. If applicable, leave them with the end user.
- De-energize before installation or servicing.
- Use only original BARTEC accessories.

NOTICE

The following instructions are provided in English only. Refer to www.bartec.us for the French version.

Sécurité

Afin de garantir la sécurité lors de l'installation et de l'utilisation du Kit de connexion PBM-200-A | PBM-200-A10, il est impératif de respecter les exigences ainsi que les consignes techniques mentionnées dans le présent manuel.

 AVERTISSEMENT

Risque d'incendie ou d'électrocution. Suivez ces consignes pour éviter toute blessure ou dommage matériel.

- Tous les systèmes et installations électriques doivent satisfaire aux exigences imposées par la société BARTEC GmbH et doivent être installés conformément aux normes électriques en vigueur ainsi qu'aux autres prescriptions nationales et locales applicables.
- La société BARTEC GmbH ainsi que les normes électriques américaines et canadiennes imposent une protection contre les défauts à la terre pour tous les circuits de traçage électrique.
- Notez que le guide de conception fourni avec chaque câble chauffant contient des informations importantes additionnelles qu'il convient de respecter en plus du présent manuel.
- La pose du kit de raccordement, des câbles chauffants et des embouts d'étanchéité doit être réalisée avec soin.
- Utilisez le câble chauffant conformément à l'usage prévu et en respectant les caractéristiques de fonctionnement spécifiées à la section *Caractéristiques techniques*.
- Le rayon de courbure du câble chauffant ne doit pas être inférieur à 1" / 25 mm. Ne pas courber le câble chauffant sur la tranche.
- Tout élément défectueux dans le kit doit être remplacé avant l'installation.
- Pour éviter un court-circuit, ne jamais raccorder ensemble les deux conducteurs du câble chauffant.
- Conservez tous les éléments et les câbles chauffants au sec avant et pendant l'installation.
- Ce kit contient de la colle silicone. Tenir hors de portée des enfants. Stocker à une température inférieure à 77 °F (25 °C). Respectez les consignes de sécurité indiquées sur l'emballage.
- Conservez ces instructions pour un usage ultérieur. Le cas échéant, remettez-les à l'utilisateur final.
- Mettez le système hors tension avant toute installation ou opération de maintenance.
- Utilisez exclusivement des pièces et accessoires d'origine BARTEC.

AVIS

Les instructions qui suivent sont fournies en anglais uniquement. Veuillez vous référer au site www.bartec.us pour la version française.

Overview

This manual covers the installation and operation of the BARTEC PBM-200-A | PBM-200-A10 Power entry kit.



The trace heating system uses a self-regulating trace heater. It features a temperature-dependent resistive heating element that regulates and limits the heat according to the ambient temperature. If the ambient temperature rises, the power output of the trace heater is reduced. This self-regulating property prevents overheating which would cause damage to the trace heater. Even crossing or overlapping with other trace heaters (or other portions of the same trace heater) are possible.


The trace heaters are fixed equipment heating systems for pipes in ordinary and hazardous areas. Thanks to the parallel design the trace heater can be cut and installed to any required length (mind the maximum heating circuit length according to system's design guide).

Compatibility

The manual applies for the following trace heaters:

- BARTEC PSB
- BARTEC MSB
- BARTEC HSB

The following terms describe the parts of the trace heater within these instructions:

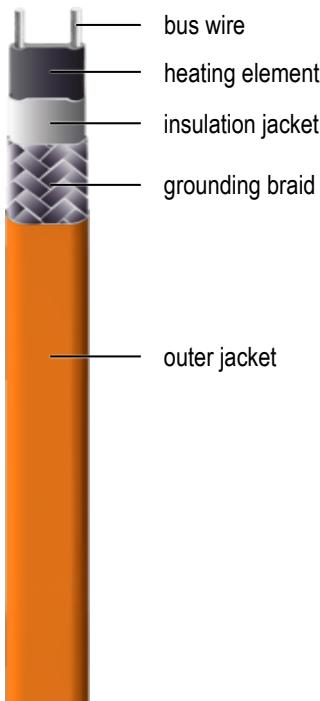

Certifications / Approvals



PBM-200-A | PBM-200-A10 Power entry kit for
BARTEC PSB, MSB and HSB trace heaters

Technical data

| | |
|-------------------------------------|--|
| Ambient temperature range | -40°F to 131°F / -40°C to 55°C |
| Min. installation temperature | -40°F / -40°C |
| Max. pipe temperature | 464°F / 240°C |
| Max. operating temperature end seal | PSB 185°F / 85°C MSB 392°F / 200°C HSB 374°F / 190°C |
| Power supply | max. 277 Vac |
| Protection classification | Class I, Div 2 Group A, B, C, D Class II, Div 2 Group E, F, G Class III |
| Ingress protection | NEMA Type 4X / IP66 |
| Conduit entry size | PBS-200-A 3/4" PBS-200-A10 1" |
| Max. power conductor size | PBS-200-A 10 AWG (6 mm ²) PBS-200-A10 6 AWG (10 mm ²) |
| Terminals | Spring clamp Ex e; 4x2 lines, 3x2 PE |

Trace heater specifications

Different types of BARTEC self-regulating trace heaters are available to suit the individual demands of your application. The following table provides the technical data for each trace heater family:

| | | <i>Trace heater specifications</i> | | |
|--|-----------------------------------|---|---|---|
| | | <i>PSB</i> | <i>MSB</i> | <i>HSB</i> |
| Maximum exposure temperature power on | | 149 °F / 65 °C | 230 °F / 110 °C | 248 °F / 120 °C |
| Maximum exposure temperature power off | | 185 °F / 85 °C | 266 °F / 130 °C | 374 °F / 190 °C |
| Minimum operation temperature | | -76 °F / -60 °C | -76 °F / -60 °C | -76 °F / -60 °C |
| Minimum installation temperature | | -40 °F / -40 °C | -40 °F / -40 °C | -40 °F / -40 °C |
| Power output¹ | | 3 to 10 W/ft / 10 to 33 W/m | 3 to 20 W/ft / 10 to 60 W/m | 5 to 20 W/ft / 15 to 60 W/m |
| Supply voltage | | max. 277 Vac | max. 277 Vac | max. 254 Vac |
| Braid resistance / Minimum percent coverage | | < 18.2 Ω/km / > 70 % | < 18.2 Ω/km / > 70 % | < 18.2 Ω/km / > 70 % |
| Braid material | | Tinned copper | Nickel-plated copper | Nickel-plated copper |
| Minimum bending radius | | 1" / 25 mm (Do not bend on the narrow axis.) | 1" / 25 mm (Do not bend on the narrow axis.) | 1" / 25 mm (Do not bend on the narrow axis.) |
| Cable weight | | 78.8 lb/100 ft / 10.9 kg/100 m | 90.364 lb/100 ft / 12.5 kg/100 m | 90.364 lb/100 ft / 12.5 kg/100 m |
| Heater dimensions | <i>fluoropolymer outer jacket</i> | 0.45" x 0.22" / 11.6 x 5.6 mm | 0.40" x 0.19" / 10.2 x 4.8 mm | 0.40" x 0.19" / 10.2 x 4.8 mm |
| | <i>polyolefin outer jacket</i> | 0.46" x 0.23" / 11.8 x 5.8 mm | n/a | n/a |
| Temperature classes ("T-Ratings") | | 3, 5 W/ft / 10, 15 W/m → T6 8, 10 W/ft / 25, 33 W/m → T5 | 3.5 W/ft / 10, 15 W/m → T4 10, 15, 20 W/ft / 30, 45, 60 W/m → T3 | 5, 10, 15 W/ft / 15, 30, 45 W/m → T3 20 W/ft / 60 W/m → T2 |

NOTICE

If you want to use plastic piping within your installation, contact your local BARTEC distributor for verification that the design does not exceed the maximum withstand temperature of the pipe material. Also, adjustments in heat loss calculations may be required.

NOTICE

For supply cable type selection, the permissible operating temperature at the conductor is to be observed with respect to the maximum ambient temperature of the power box.

Power supply cable: Service temperature at the conductor must withstand a temperature of 85°C.

AVIS

Si vous souhaitez utiliser de la tuyauterie en plastique dans votre application, veuillez contacter votre distributeur BARTEC local afin de lui faire vérifier que la température maximale supportable ne soit pas excédée. De plus, des adaptations des calculs de perte de chaleur peuvent s'avérer nécessaires.

AVIS





Pour la sélection du type de câble d'alimentation, la température de service admissible au niveau du conducteur doit être respectée par rapport à la température ambiante maximale du boîtier d'alimentation.

Câble d'alimentation: La température de service au niveau du conducteur doit résister à 85°C.

¹ nominal heat output at 10 °C

Kit contents

The following table lists the kit contents of the PBM-200-A | PBM-200-A10 Power entry kit²:
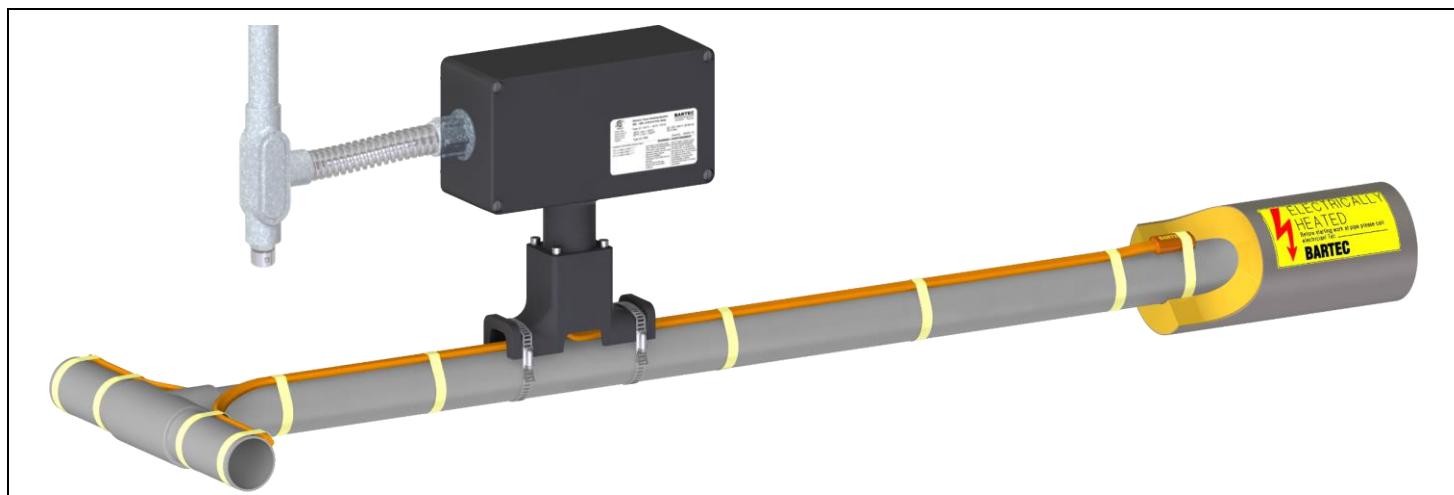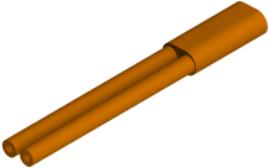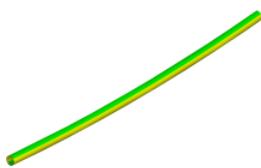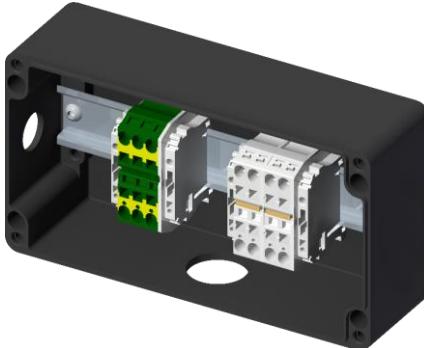
| | | | | | | | |
|---|---|---|---|--|--|--|--|
|  <p>PBM-200-A PBM-200-A10 Power entry kit</p> | | | | | | | |
|  3 x Silicone pants |  3 x End seal |  3 x Green/yellow tube for grounding braid |  3 x Silicone adhesive | | | | |
|  1 x Cover for junction box incl. 4 fixing screws | |  1 x Junction box with connection terminals "-A" junction boxes: 220 x 120 x 90 mm "-A10" junction boxes: 260 x 160 x 90 mm | | | | | |
|  3 x Trace heater grommet |  1 x Top unit of the mounting stand incl. sealing ring and lock nut |  1 x Base unit of the mounting stand | | | | | |

² Note that the illustrations might vary depending on whether you use the PBM-200-A or the PBM-200-A10 kit.

Accessories

The following accessories are available for the PBM-200-A | PBM-200-A10 Power entry kit.

| | | |
|--|-------------------------|--|
|  | Glass cloth tape | Catalog No.: GT-108 Order No.: 100306 Part No.: 02-5500-0047 |
| <p>for attaching self-regulating trace heaters on all pipes including stainless steel / required during preparation of power limiting trace heaters</p> <p>1/2" x 108 ft (33 m) per roll Minimum installation temperature (dry surface): 15 °F (-10 °C) Maximum withstand temperature: 392 °F (200 °C)</p> | | |


Tip: Refer to the following table to estimate the required number of tape rolls for your installation (for attaching trace heaters on pipes only)

| Pipe diameter in inch (DN) | 1/4" (DN8) | 1/2" (DN15) | 3/4" (DN20) | 1" (DN25) | 1 1/4" (DN32) | 1 1/2" (DN40) | 2" (DN50) | 2 1/2" (DN65) | 3" (DN80) | 4" (DN100) | 6" (DN150) | 8" (DN200) | 10" (DN250) | 12" (DN300) | 14" (DN350) | 16" (DN400) | 18" (DN450) | 20" (DN500) | 24" (DN600) |
|--|------------|-------------|-------------|-----------|---------------|---------------|-----------|---------------|-----------|------------|------------|------------|-------------|-------------|-------------|-------------|-------------|-------------|-------------|
| Required no. of tape rolls per 100 ft (30 m) of piping | 1 | 1 | 1 | 1 | 2 | 2 | 2 | 3 | 3 | 4 | 5 | 7 | 9 | 10 | 11 | 12 | 14 | 15 | 18 |

| | | |
|---|--------------------------------|--|
|  | Polyester adhesive tape | Catalog No.: PT-164 Order No.: 100706 Part No.: 02-5500-0005 |
| <p>for use on pipes other than stainless steel</p> <p>3/4" x 164 ft (50 m) per roll Minimum installation temperature (dry surface): 40 °F (5 °C) Maximum withstand temperature: 212 °F (100 °C)</p> | | |

Tip: Refer to the following table to estimate the required number of tape rolls for your installation:

| Pipe diameter in inch (DN) | 1/4" (DN8) | 1/2" (DN15) | 3/4" (DN20) | 1" (DN25) | 1 1/4" (DN32) | 1 1/2" (DN40) | 2" (DN50) | 2 1/2" (DN65) | 3" (DN80) | 4" (DN100) | 6" (DN150) | 8" (DN200) | 10" (DN250) | 12" (DN300) | 14" (DN350) | 16" (DN400) | 18" (DN450) | 20" (DN500) | 24" (DN600) |
|--|------------|-------------|-------------|-----------|---------------|---------------|-----------|---------------|-----------|------------|------------|------------|-------------|-------------|-------------|-------------|-------------|-------------|-------------|
| Required no. of tape rolls per 100 ft (30 m) of piping | 1 | 1 | 1 | 1 | 1 | 1 | 2 | 2 | 2 | 3 | 4 | 5 | 6 | 7 | 7 | 8 | 9 | 10 | 12 |
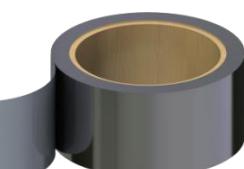
| | | |
|--|-------------------------------|---|
|  | Aluminum adhesive tape | AT80: Catalog No.: AT80-164 Order No.: 100506 Part No.: 02-5500-0003 |
| <p>for use on all pipe materials</p> <p>2" x 164 ft (50 m) per roll</p> <p>AT80: Minimum installation temperature (dry surface): 40 °F (5 °C) Maximum withstand temperature: 176 °F (80 °C)</p> <p>AT150: Minimum installation temperature (dry surface): 40 °F (5 °C) Maximum withstand temperature: 302 °F (150 °C)</p> <p><i>Tip:</i> The required number of tape rolls per 100 ft (30 m) of pipe is 0.6.</p> | | |

| | | |
|---|------------------------------------|---|
|  | Stainless steel pipe straps | for pipe ø up to 3" / DN80: Catalog No.: PC-1 Order No.: 435727 |
| <p>stainless steel, for attaching mounting stands on pipes etc. No special tooling required.</p> <p>for pipe ø up to 10" / DN250: Catalog No.: PC-2 Order No.: 435729</p> | | |

**Small pipe adaptor**

Adaptor for pipe diameters of less than 25 mm for use with PBM-200 kits.

Catalog No.: PBM-SPA
Order No.: 436001
Part No.: 05-1105-0072

**Electrically traced warning label**

Warning label for trace heater circuits

Recommended: electrical warning label every 10 ft. (3 m) on the outside of the thermal cladding on a clearly visible place.

Packaged in rolls of 100 pieces

English:

Catalog No.: HTWL-US
Order No.: 113550
Part No.: 05-2144-0047

French:

Catalog No.: HTWL-FR
Order No.: 120300
Part No.: 05-2144-0703

End termination**CAK-E5/E10 Cold applied end seal**

Silicone end seal for insulation of the end of the trace heater.

CAK-E5 5 pcs.
CAK-E10 10 pcs.

For a complete list of kit contents and approvals see data sheet.

CAK-E5:

Catalog No.: CAK-E5
Order No.: 404126
Part No.: 27-59CZ-90000001

CAK-E10:

Catalog No.: CAK-E10
Order No.: 404128
Part No.: 27-59CZ-90000010

**ELS-200 high profile end seal**

End seal for access above the insulation. The kit is approved for Class I, II and III Div 2 areas.

2 pipe straps per stand required.
For a complete list of kit contents and approvals see data sheet.

Catalog No.: ELS-200


Order No.: 430293
Part No.: 27-54E2-4012/A000

Spare parts**On pipe cable gland kit and end seal**

Spare parts kit for use with PBS/PBM-200 kits for replacement of damaged or lost parts.

Catalog No.: CAK-SRS

Order No.: 434968
Part No.: 27-59CX-7C01/0001

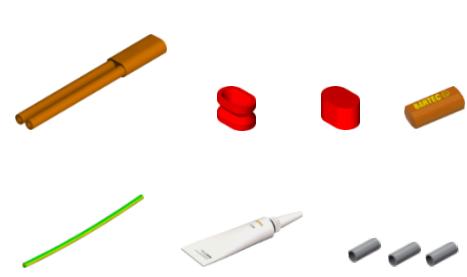

**On pipe cable gland kit and end seal
spare parts kit for replacement of damaged or
lost parts**

Catalog No.: CAK-D5-A

Installation


Required tools / equipment

The following tools and equipment are required for installation of the PBM-200-A | PBM-200-A10 Power entry kit:

- Wire cutters
- Flat screwdriver
- Electricians screwdriver
- Tape measure
- Utility knife
- Needle-nose pliers (2x)
- Adjustable wrench (2x)
- 4 mm hex wrench



- NEMA Type 4X rated conduit pipe and conduit hub with conduit drain.

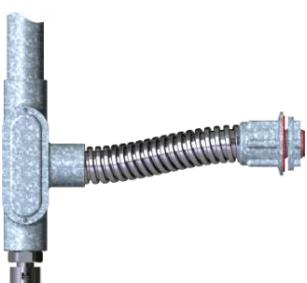

1

Cautions and warnings

WARNING

Risk of fire or electrical shock. De-energize all power circuits before installation or servicing. Always use ground fault equipment protection with the trace heating system.

AVERTISSEMENT

Risque d'incendie ou d'électrocution. Mettre tous les circuits électriques hors tension avant toute installation ou opération de maintenance. Toujours utiliser un dispositif de protection contre les défauts à la terre au sein du système de traçage électrique.

- Double-check that all power circuits are de-energized before you begin your work.
- Make sure that you do not exceed the maximum heating circuit length for the trace heater type you use. Refer to the design guide of the heating system.



2

Unrolling the trace heater


WARNING

Risk of short circuit and/or material damage. Keep the trace heater ends dry before and during installation. Observe the design guide of the trace heating system.

AVERTISSEMENT

Risque de court-circuit et/ou de dommages matériels. Conservez les extrémités du câble chauffant au sec avant et pendant toute la durée de l'installation. Respectez les indications fournies dans le guide de conception du système de traçage.

- Unroll the required trace heater in a straight line and cut to the correct length. Cut off the trace heater ensuring a straight cut.
- Do not bend or pinch the trace heater, or pull it over sharp edges.

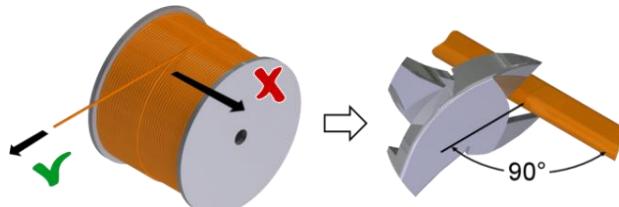

3

Installation on pipes


This step is necessary for plastic pipes only since plastic pipes conduct heat less efficiently than metal pipes do. For metal pipes refer to step 5.

- Place aluminium tape where the trace heater will be attached for better heat distribution.



4

- Preferably install the trace heater in the lower half of the pipe, **but not on the lowest point**. This prevents mechanical damage and allows for better heat distribution.
- If you use multiple trace heaters, position them with an offset of 90°.

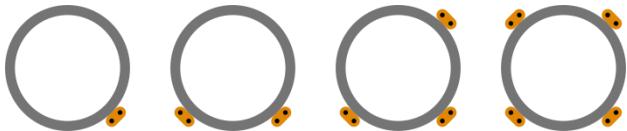

6

⚠ CAUTION

Risk of injury and/or material damage. Never step on or drive over the trace heater. Do not use it as a loop for stepping on.


⚠ ATTENTION

Risque de blessures et/ou de dommages matériels. Ne pas marcher ni rouler sur le câble chauffant. Ne pas s'en servir comme cordage.

- Preferably install the trace heater in a straight line along the pipe. This saves time, helps to avoid installation mistakes and prevents damage to the trace heater during the thermal insulation work.



- The trace heater should be installed spirally only if this is expressly specified in the project planning. Make sure to wrap the loops in opposite directions.

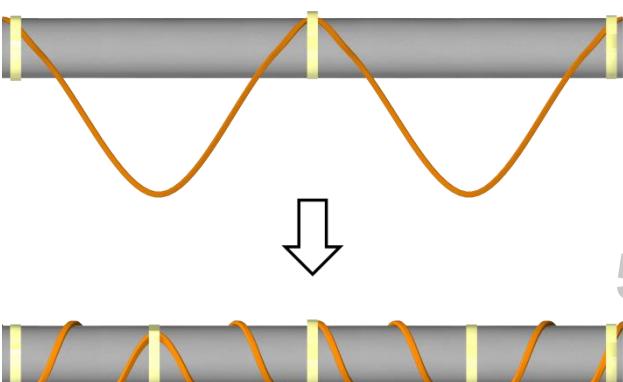

5

NOTICE

When installing allow for an additional length of trace heater for assembling splice connections, tee branches, end seals etc. (approx. 1.6 ft (0.5 m) for each).

AVIS

Lors de la pose, réservez une longueur additionnelle de câble chauffant pour l'assemblage des jonctions de fil, des dérivations en T, embouts d'étanchéité, etc. (env. 1,6 ft (0,5 m) dans chaque cas).

Fastening

Select the correct fastening material:

- Use polyester adhesive tape or glass cloth tape that suits the expected temperatures.
- Preferably use BARTEC adhesive tapes.
- Never use PVC electrical tape or self-adhesive tapes containing PVC or VC.
- Do not use metal wire or banding.



7

- Fasten the trace heater with the adhesive tape at intervals of at least 12" (300 mm) on plastic pipes or 36" (900 mm) on steel pipes.



NOTICE

In order to ensure good heat transfer the trace heater should have a flat, flush fit over the whole length. If necessary, reduce the distances between the fixing points.


AVIS

Pour assurer une bonne conduction thermique, le câble chauffant doit être posé bien à plat et bien au contact de la tuyauterie sur toute la longueur. Au besoin, réduisez l'écartement entre les points d'attache.


8

For 1 or 2 trace heater(s):

- Pass the trace heater(s) through the base unit of the mounting stand.
- Do not fix the mounting stand on the pipe yet.

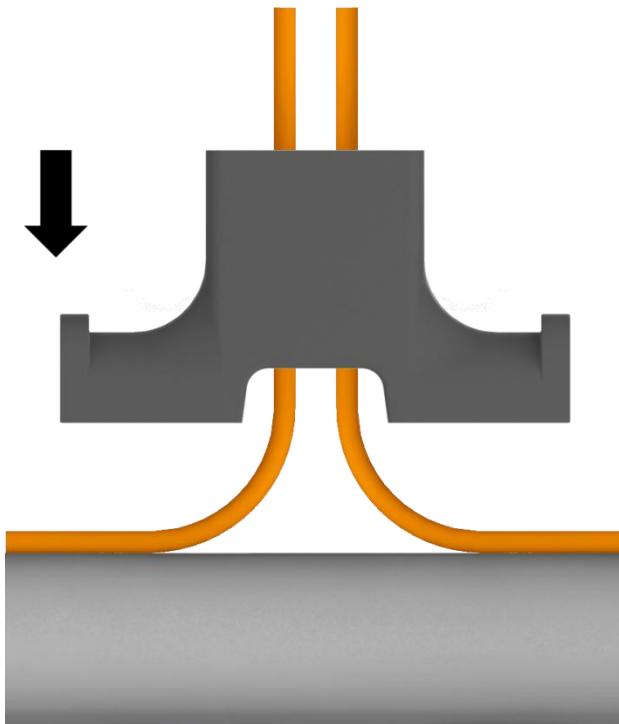**For 3 trace heaters:**


- Pass the 3 trace heaters through the base unit of the mounting stand as shown.
- Do not fix the mounting stand on the pipe yet.

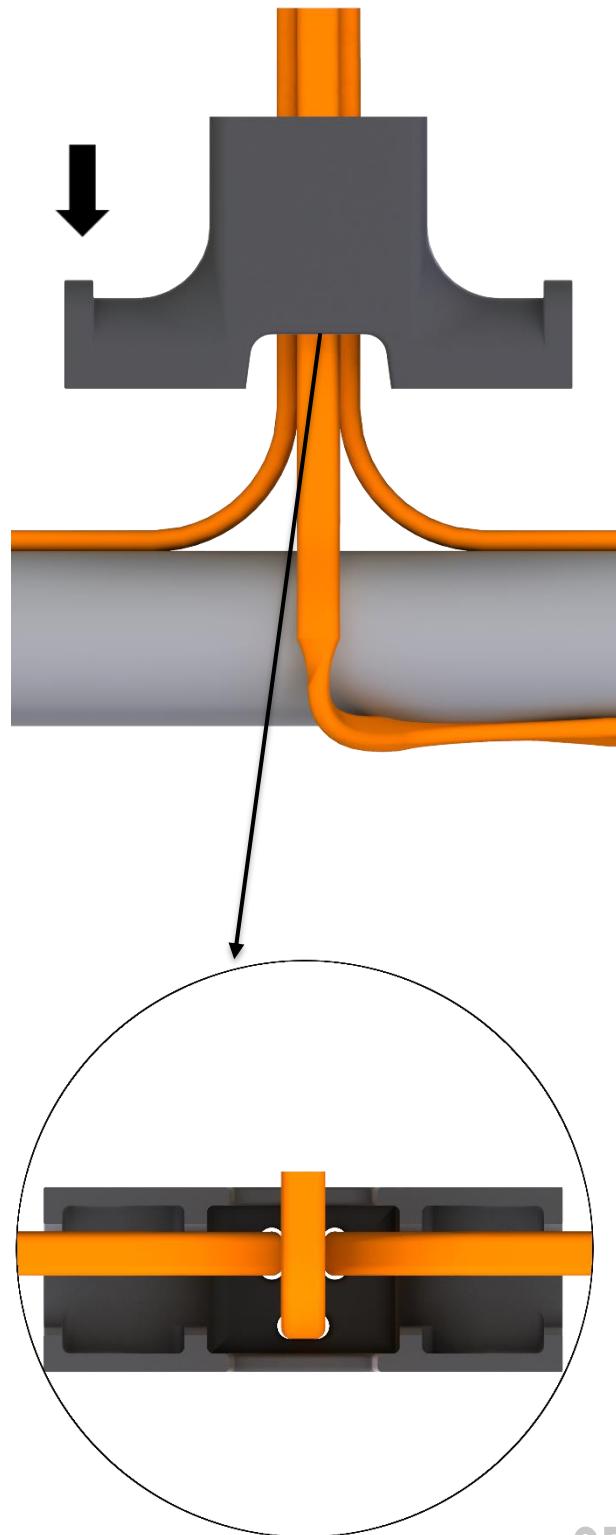

9A


9B

- Slide a trace heater grommet onto the trace heater(s) and into the seal seat.
- Slide a trace heater grommet into the free seal seats, if any.
- Make sure that the trace heaters stand out approximately 10" (25 cm). This makes cable preparation easier.

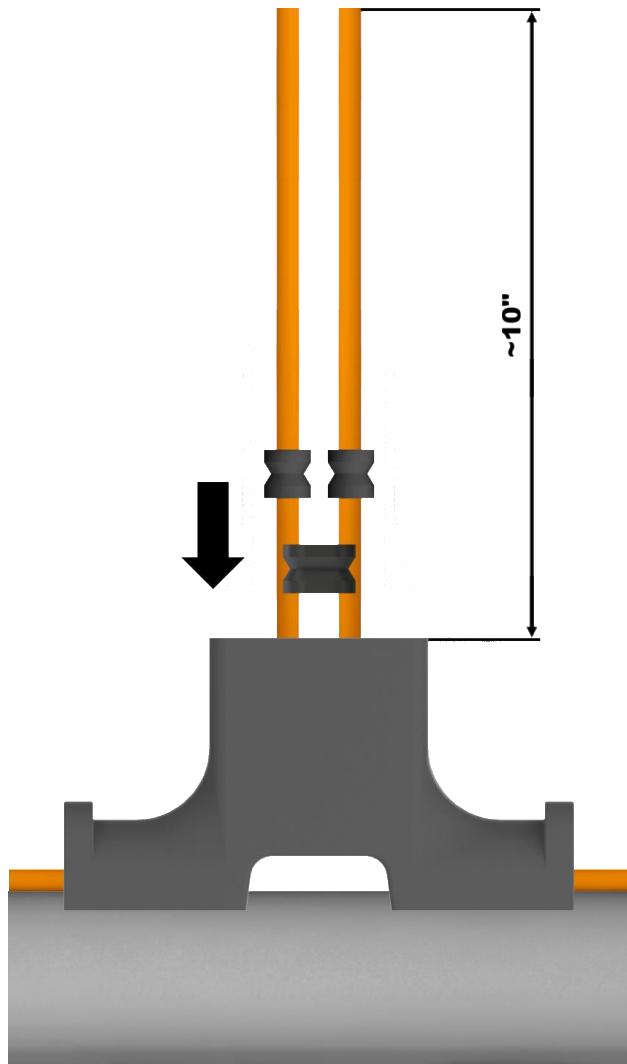

10


- Slide the top unit of the mounting stand over the trace heater(s).
- Slightly tighten the 4 fixing screws using a crosshead screwdriver. Do not tighten them fully yet to allow the trace heaters to be moved.

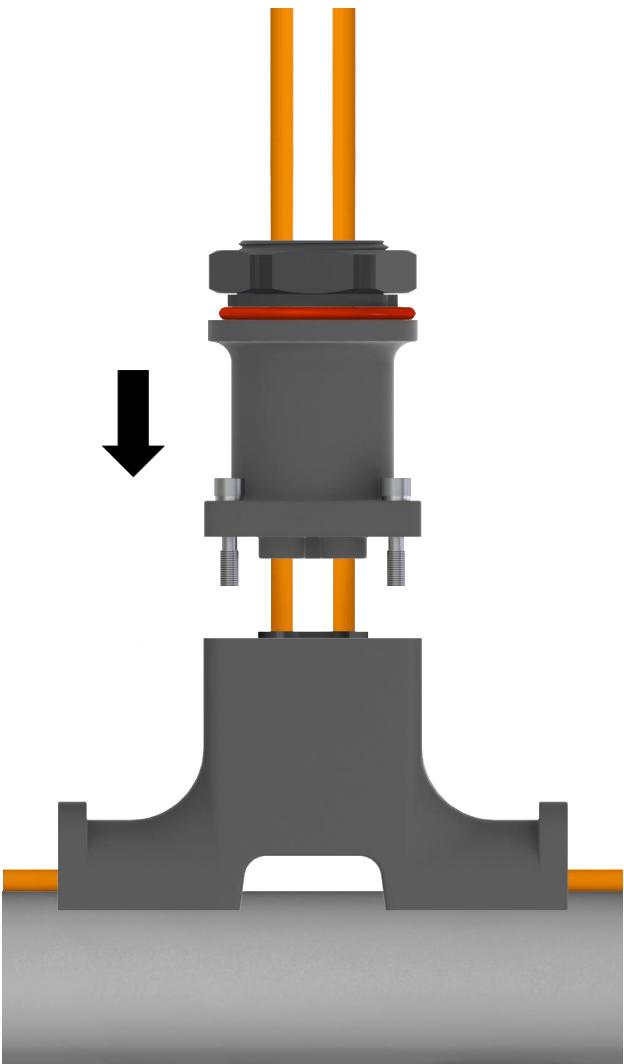

11


Repeat steps 12-25 for all trace heaters.

- Remove 5 3/4" (145 mm) of the outer jacket on the end of the trace heater.

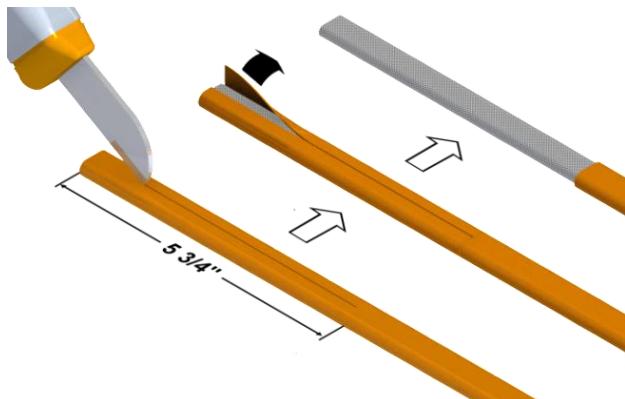


12

- Push the grounding braid back. Use the screwdriver to form an eyelet. Be careful not to damage the internal insulation jacket.

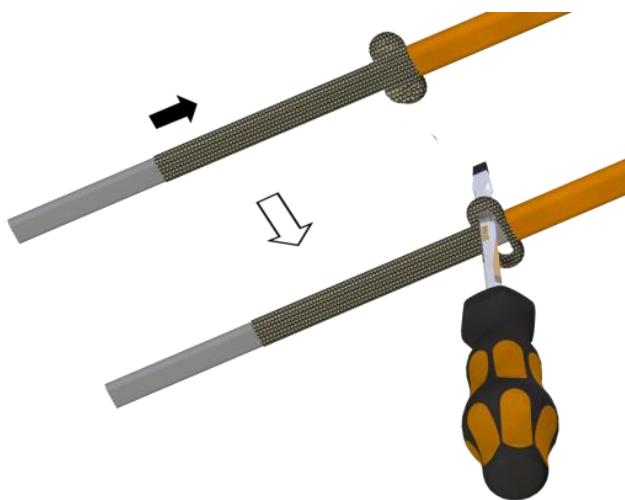

13

- Bend the trace heater and pull the heating element out of the grounding braid.

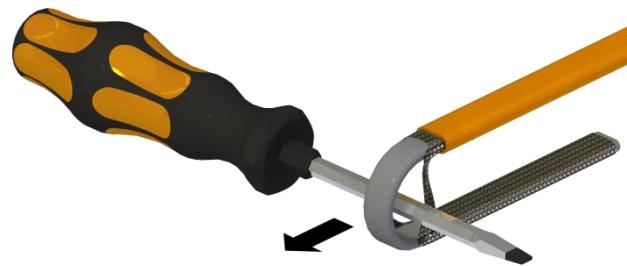


14

- Twist the grounding braid in order to form a pigtail.




15

- Push the green/yellow tube onto the twisted grounding braid.

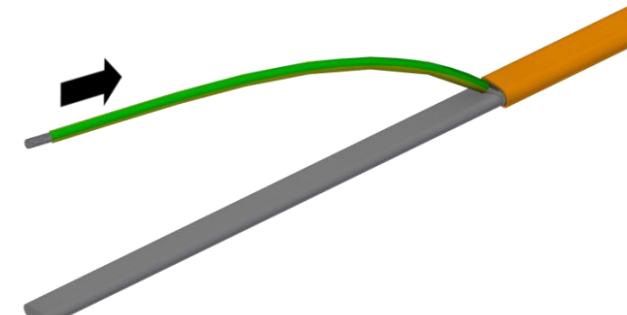


16

- Remove 4 1/2" (115 mm) of the internal insulation jacket. Take care not to damage the bus wires.

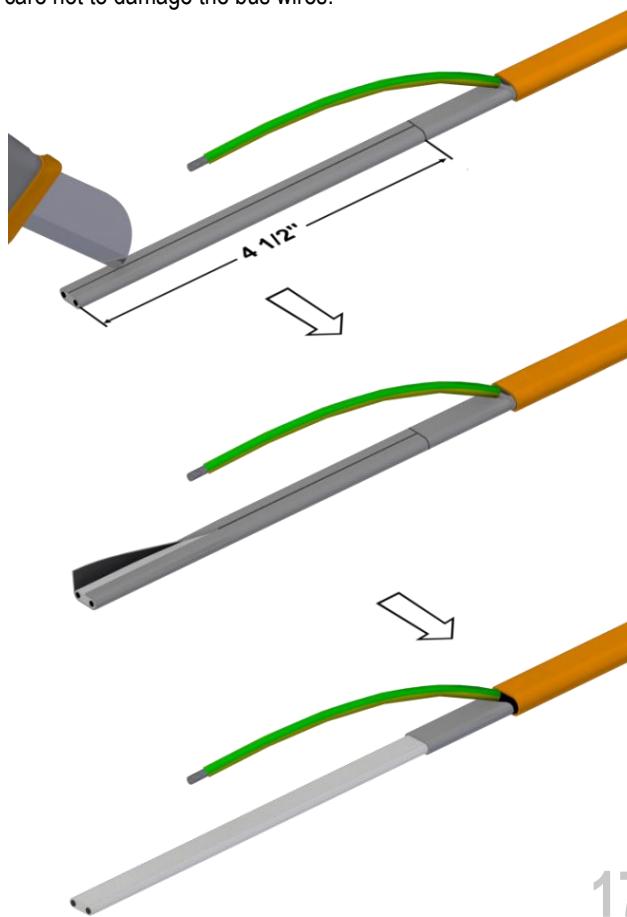

17

- Carefully make an incision into the edges of the heating element. Take care not to damage the bus wires.

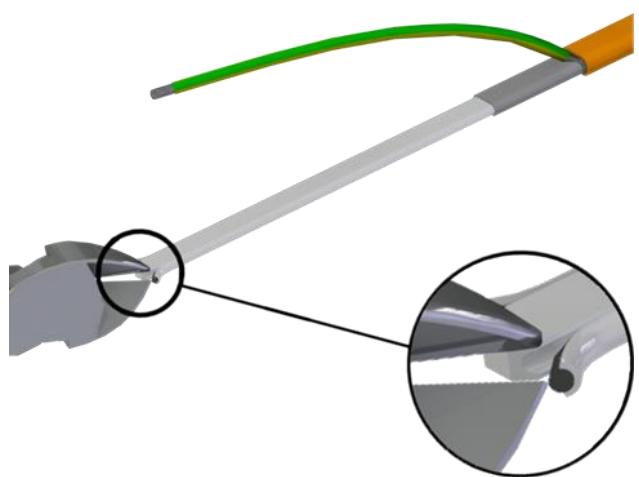

18

- Pull off the bus wires while holding the heating element.



19

- Remove any remaining heating element that sticks to the bus wires.


⚠ CAUTION

Risk of malfunction of the heating system. Before you continue, make sure that the bus wires are intact and not nicked or damaged.

⚠ ATTENTION


Risque de dysfonctionnement du système de traçage. Avant de continuer, assurez-vous que les fils conducteurs sont intacts, qu'ils ne sont pas incisés ni endommagés.

- Twist the bus wires.

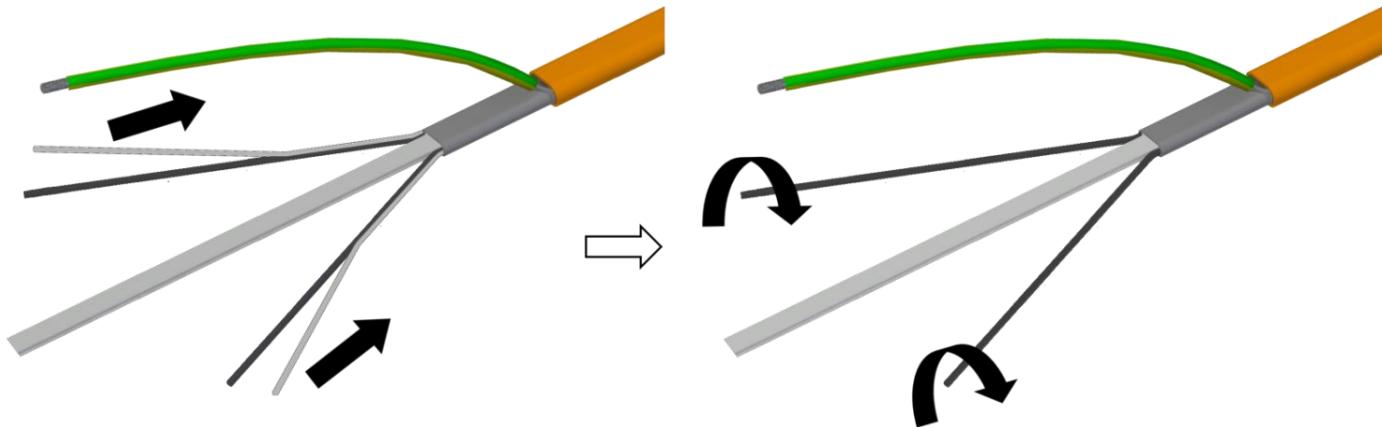


20

- Remove the remaining heating element. Take care not to damage the bus wires.

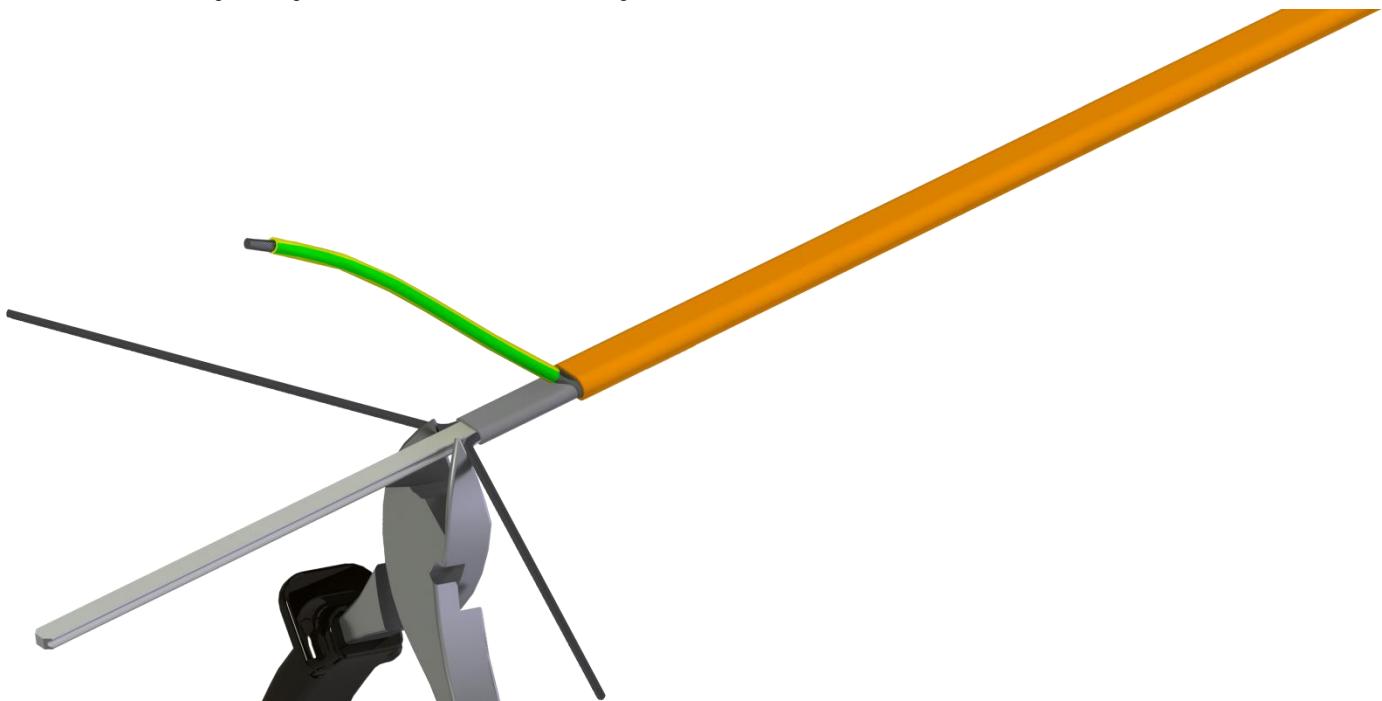


21

- Carefully cut in a triangle (1/4" / 5 mm) between the bus wires. Take care not to damage the bus wires.

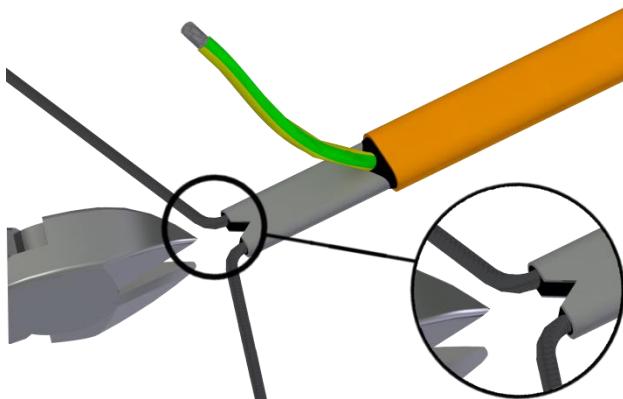

22

- Make sure that all bus wires are intact and not nicked or damaged.

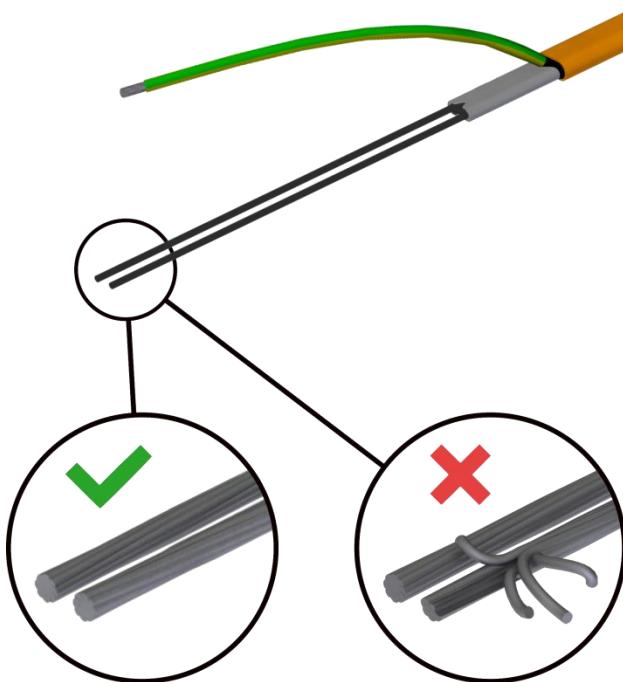

23


CAUTION

The silicone adhesive may cause irritation to skin and eyes. Avoid eye contact. Avoid repeated or prolonged skin contact. In case of contact with eyes, rinse with water and seek medical advice.

ATTENTION


La colle silicone peut irriter la peau et les yeux. Eviter tout contact avec les yeux. Eviter tout contact répété ou prolongé avec la peau. En cas de contact avec les yeux, rincer à l'eau claire et consulter un médecin.

- Put silicone adhesive onto the exposed heating element and insulation jacket.

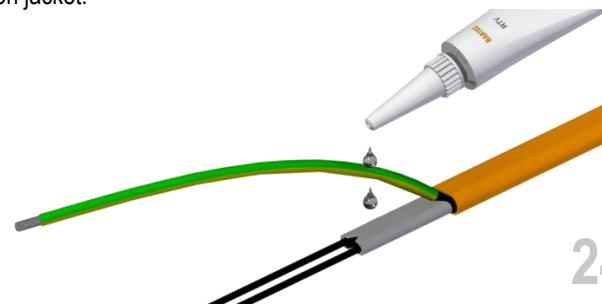


24

- Thread the bus wires into the silicone pants.
- You might add further silicone adhesive to ensure optimal sealing.
- Slide the silicone pants all the way onto the heating element.

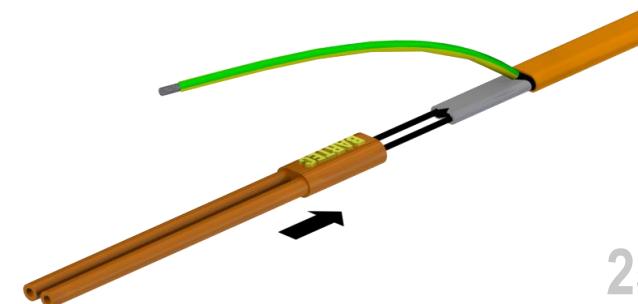


25

- Optional: Crimp a ferrule onto the twisted grounding braid. Not necessary at spring clamp terminals in power connection boxes.

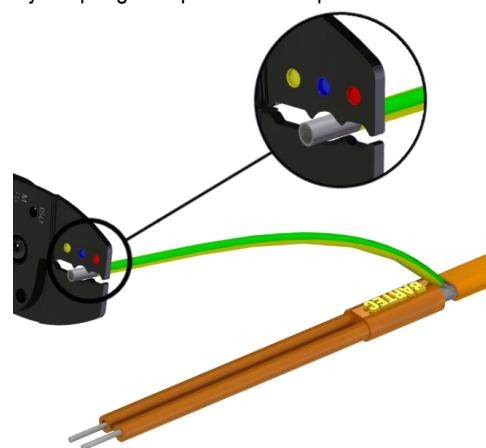

26


- Optional: Crimp a ferrule onto each of the bus wires. Not necessary at spring clamp terminals in power connection boxes.

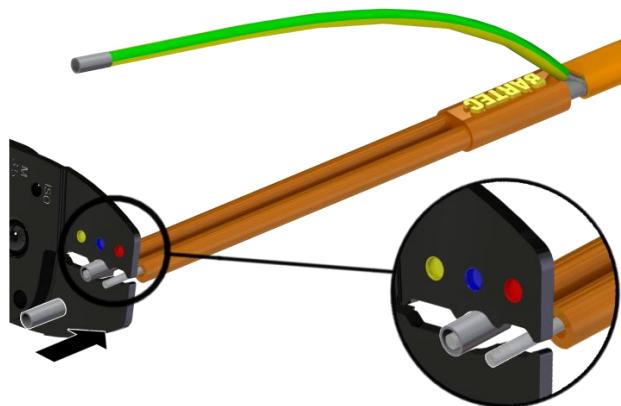

27


Installation of the mounting stand

- Pull back the trace heaters. For easy cable connection it is enough when the silicone pants stands out of the mounting stand.

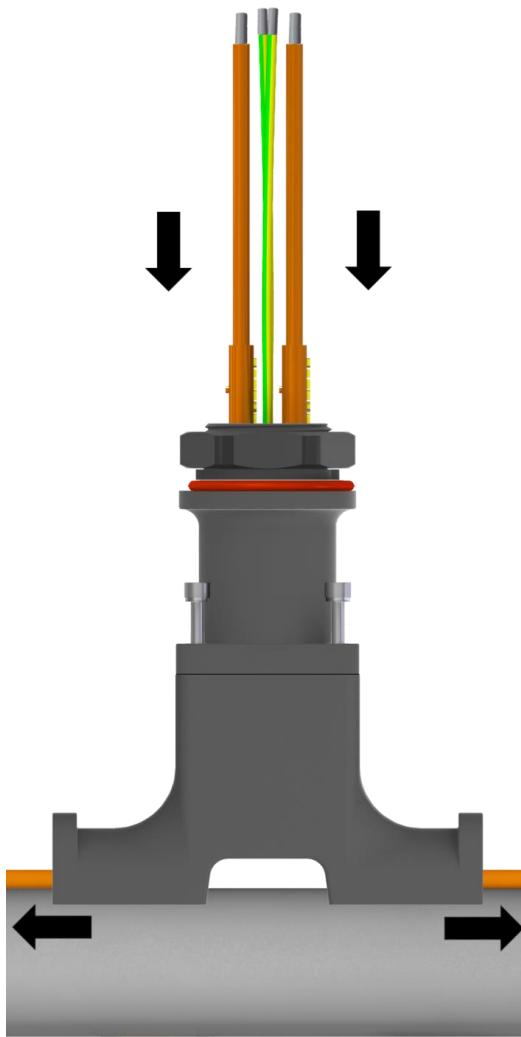


28

- Now, tighten the 4 fixing screws of the top unit of the mounting stand using a 4 mm hex wrench.

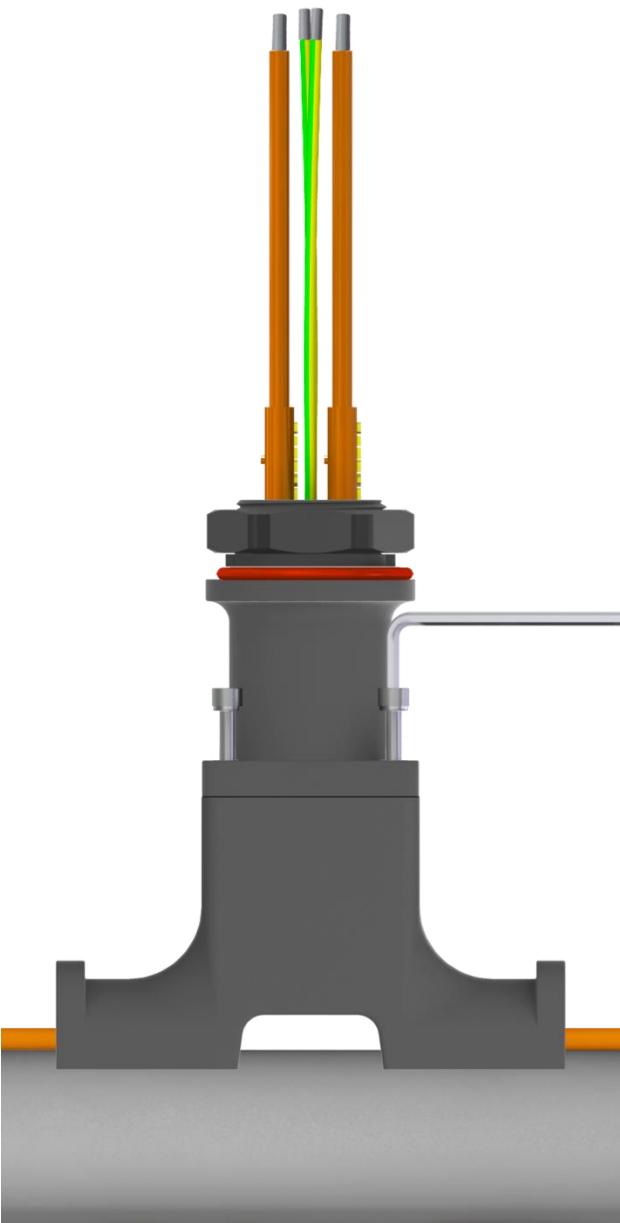


29

- Install the pipe straps and tighten them firmly to affix the stand to the pipe.

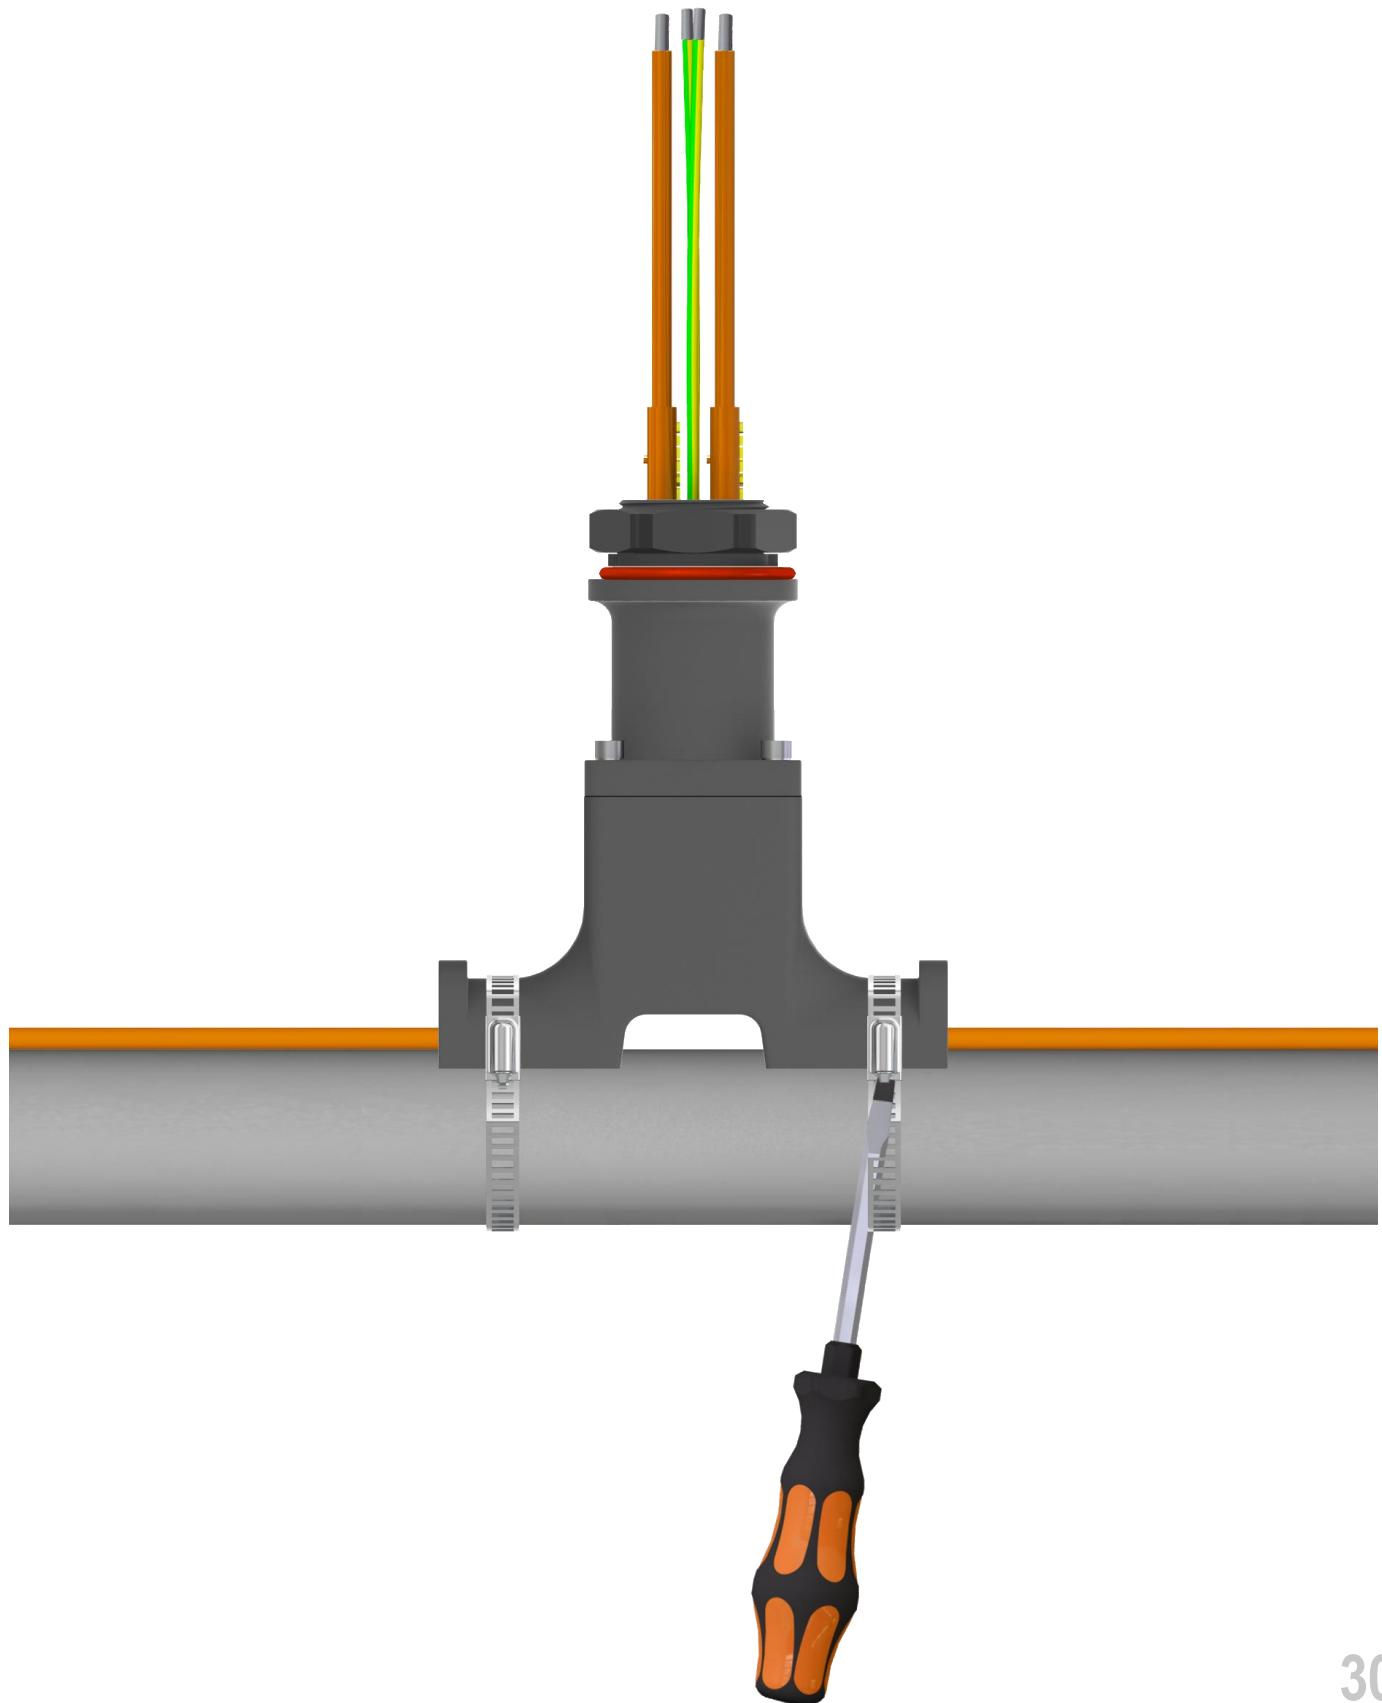


Cable connection

- Unscrew the lock nut of the top unit of the mounting stand.
- Feed the prepared trace heater into the junction box.
- Slide the junction box onto the top unit of the mounting stand.
- Install the lock nut and tighten it using an adjustable wrench.

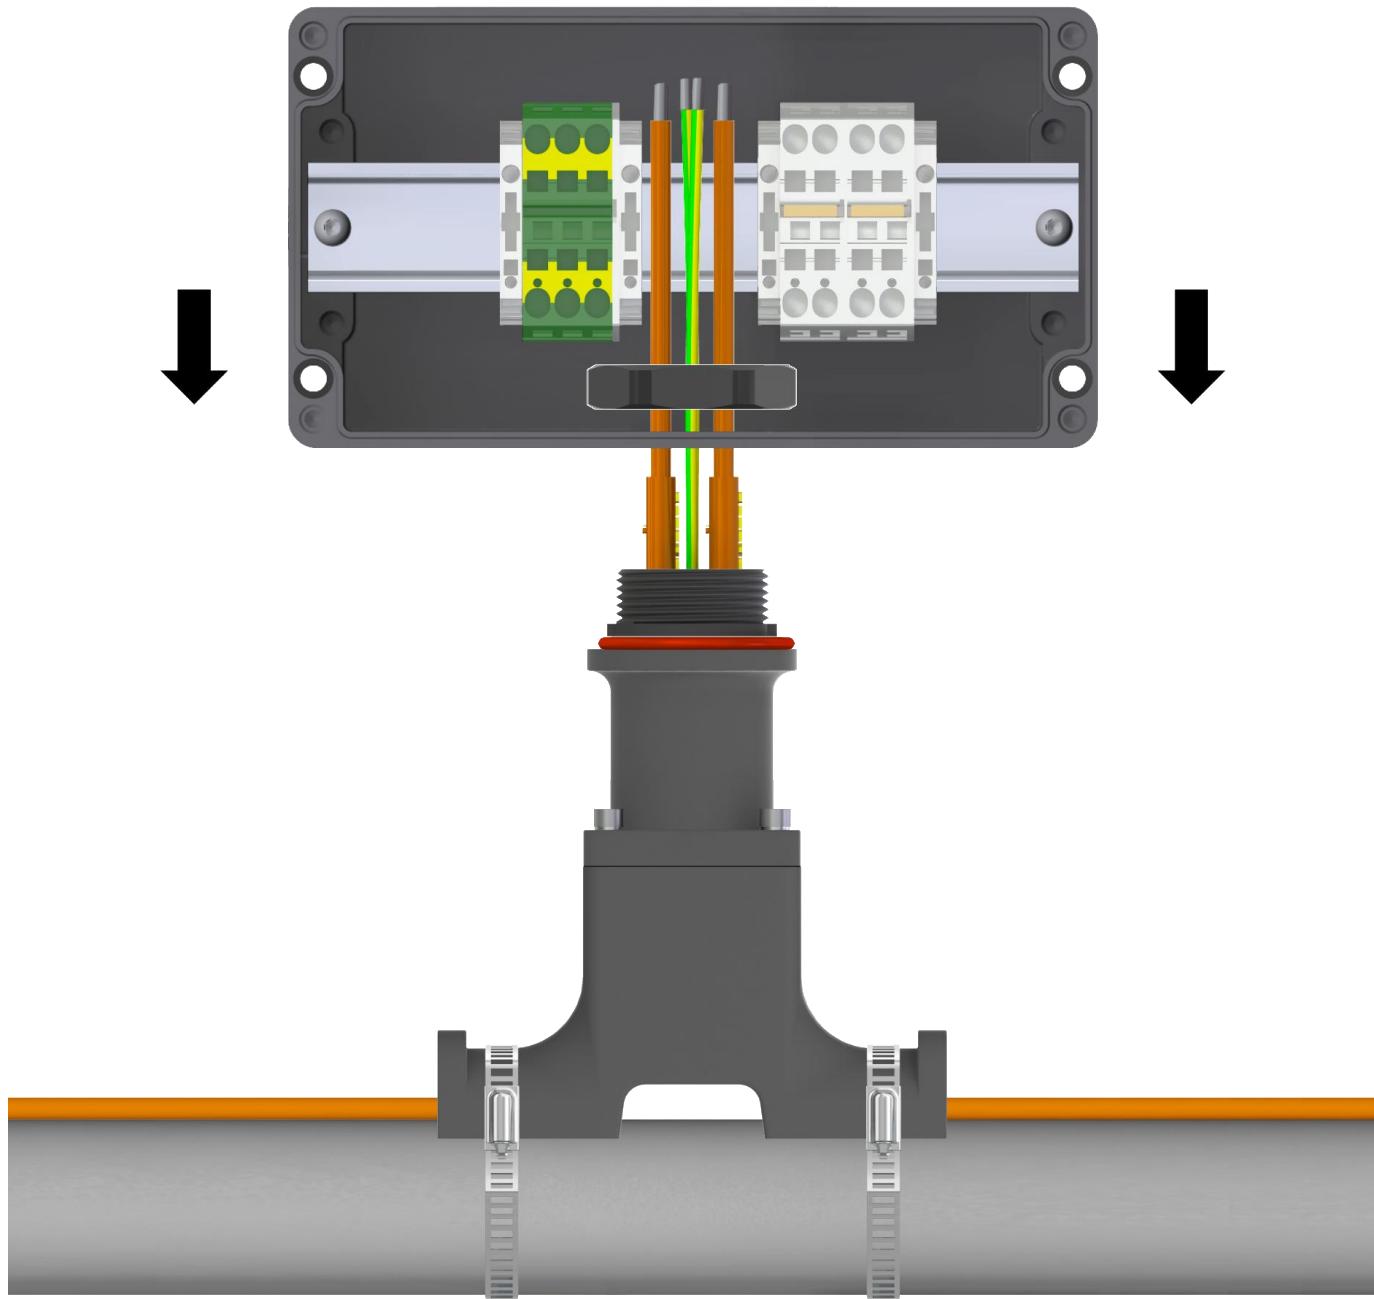


For powered connections refer to step 33 on page 21. For T-connections continue here (PBM-200-A only).

- Use a Crouse Hinds Myers cap-off (catalog no. STC 2 - 3/4" or STAC 2 - 3/4") or approved equal kit to seal the power entry hole.
- Install and tighten the kit according to the manufacturer's instructions.

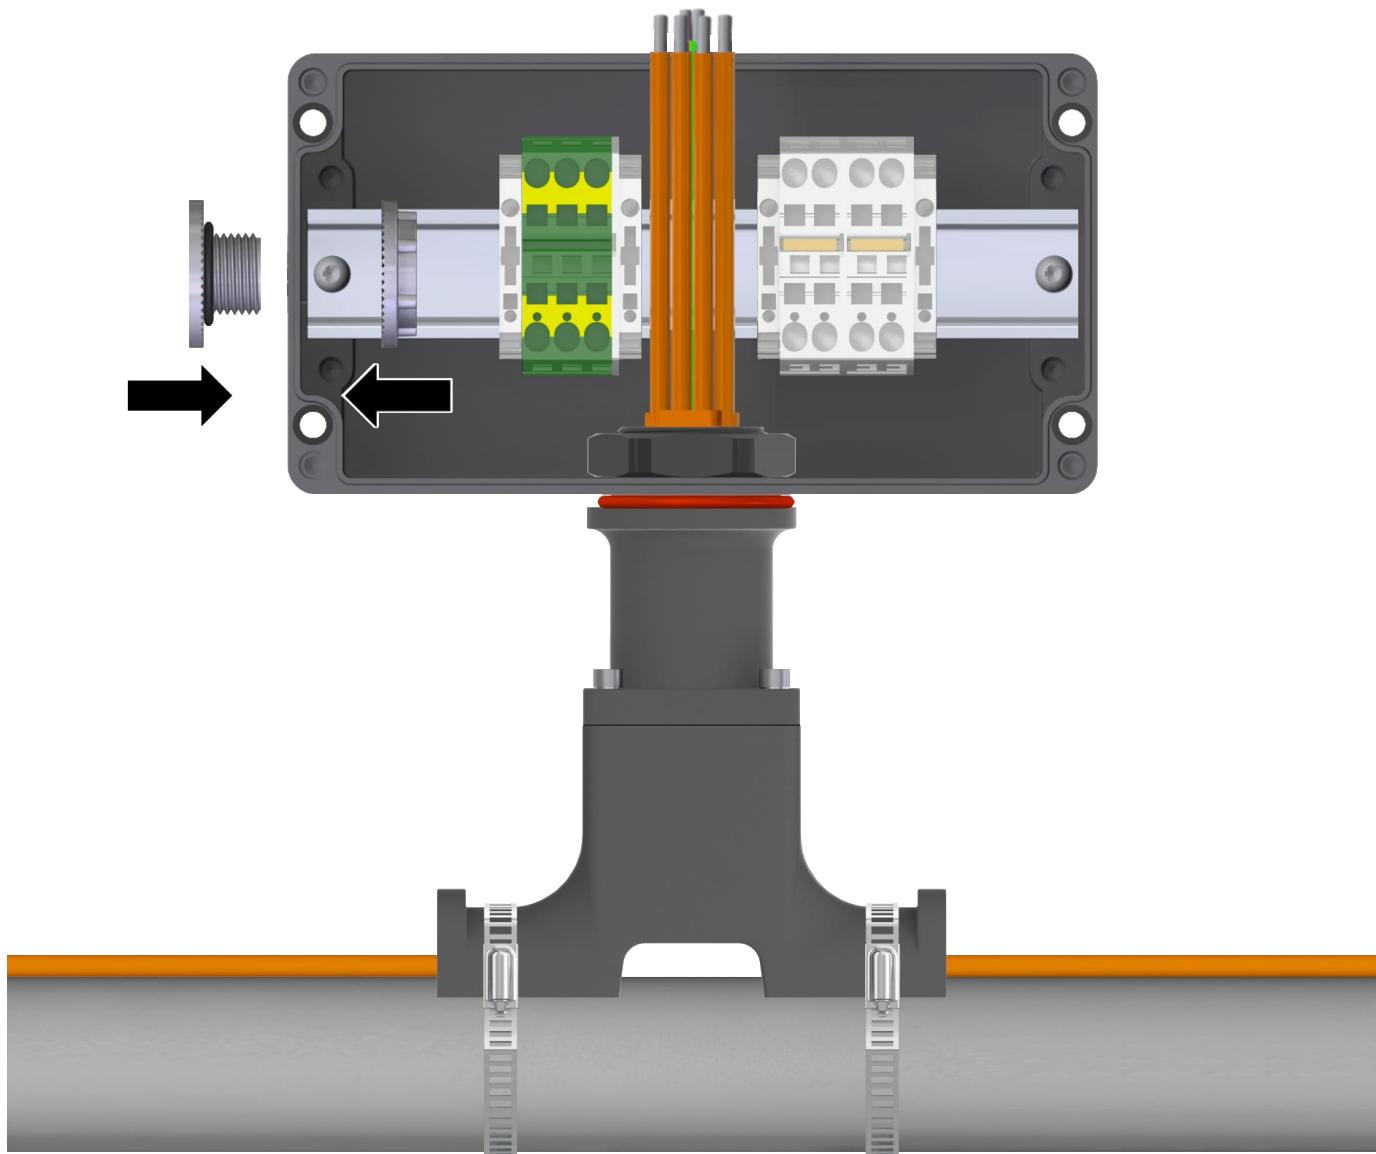

For powered connections only. For T-connections refer to step 32 on page 20.

- Install the conduit pipe and conduit hub according to the manufacturer's installation instructions.
- Feed the cold lead cable into the junction box.

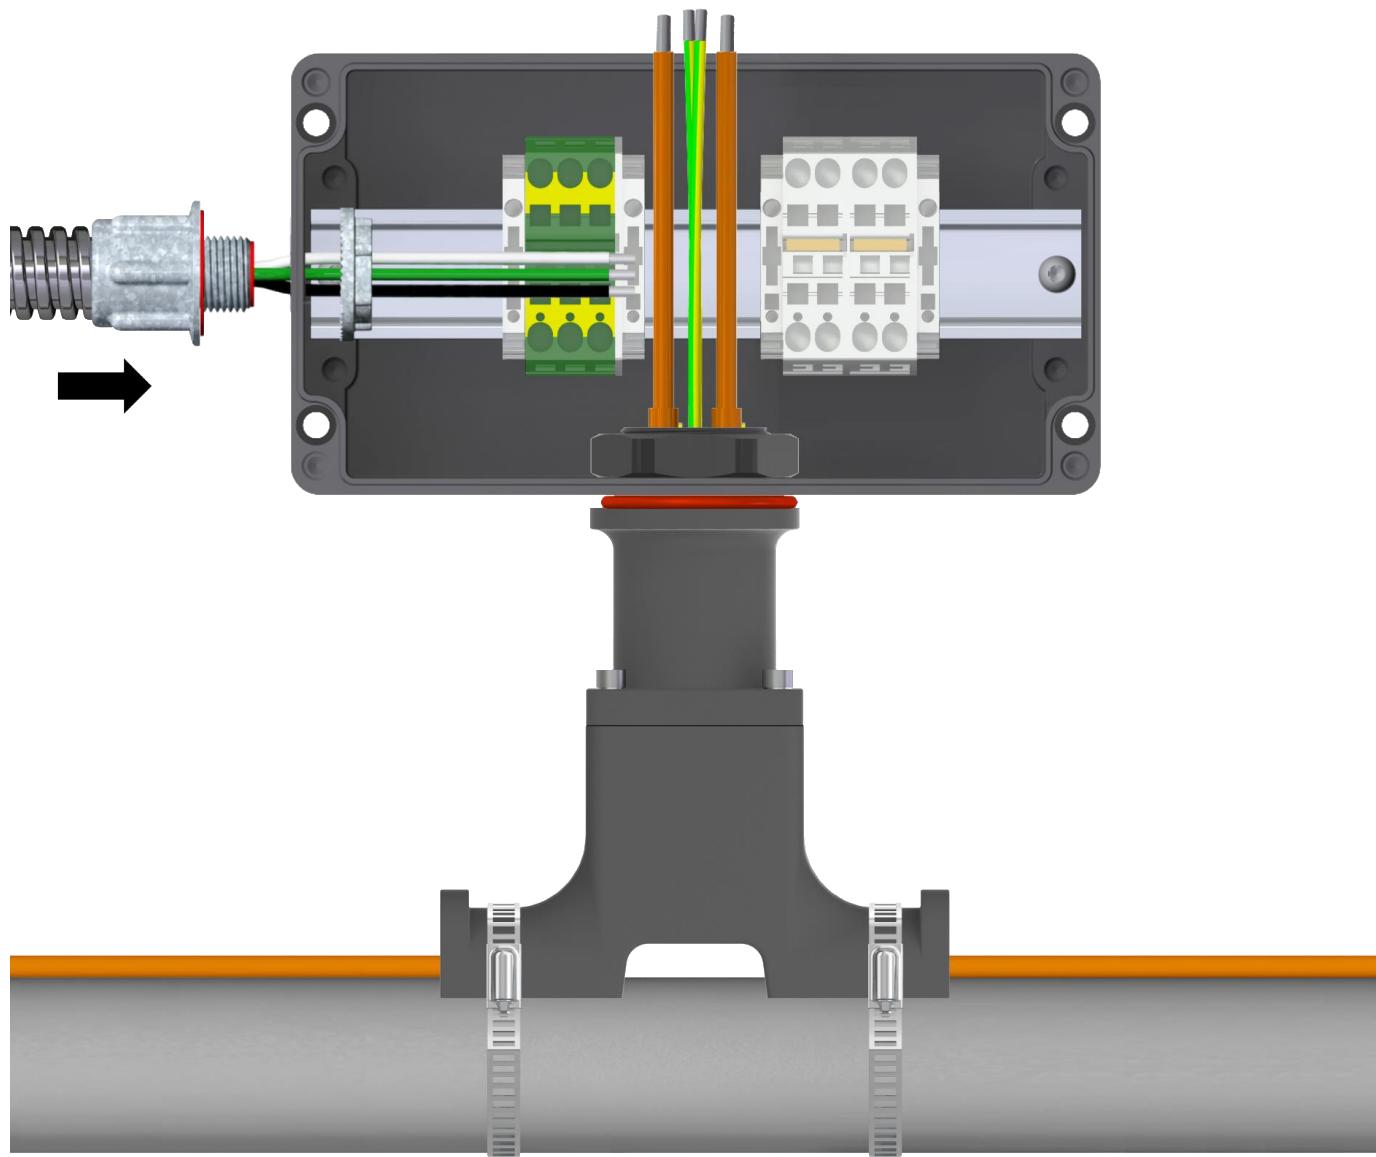

NOTICE

The conduit entry size is 3/4" for PBM-200-A and 1" for PBM-200-A10.

Power supply cable: Service temperature at conductor must withstand a temperature of 85°C.


AVIS

L'entrée de conduit et de 3/4" pour PBM-200-A et de 1" pour PBM-200-A10.


Câble d'alimentation: La température de service au niveau du conducteur doit résister à 85°C.

Wiring

- For wire connection at the spring clamp terminals, insert a small screwdriver into the screwdriver slot, then insert the wire.
- Connect all wires as shown.

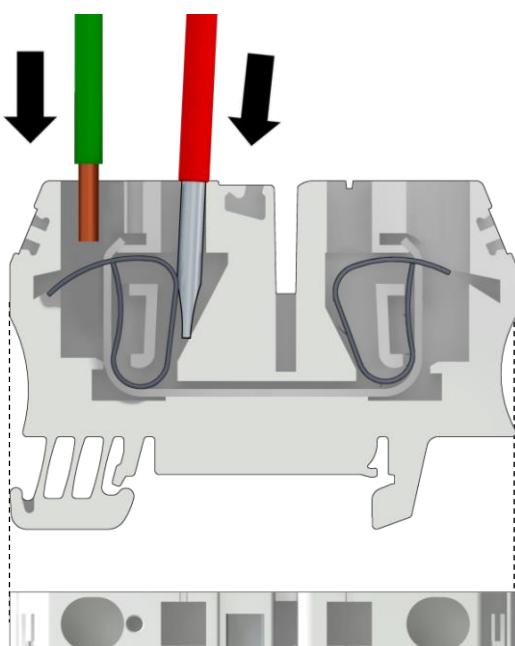


Power connection wiring

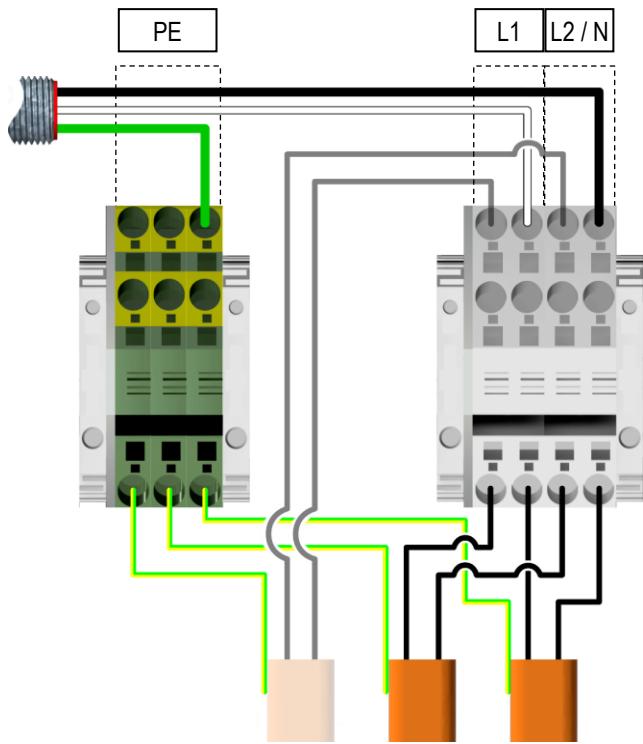



34A

T-connection wiring

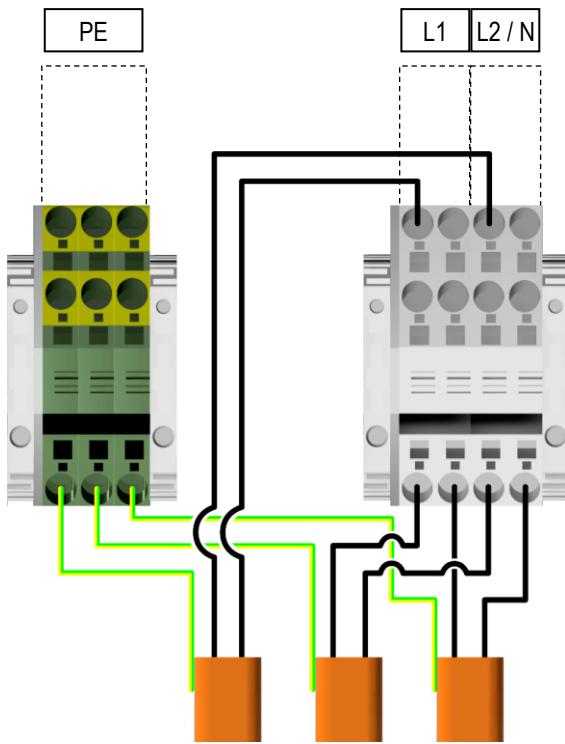

34B


- Mount the cover of the junction box and tighten the 4 fixing screws using a screwdriver.

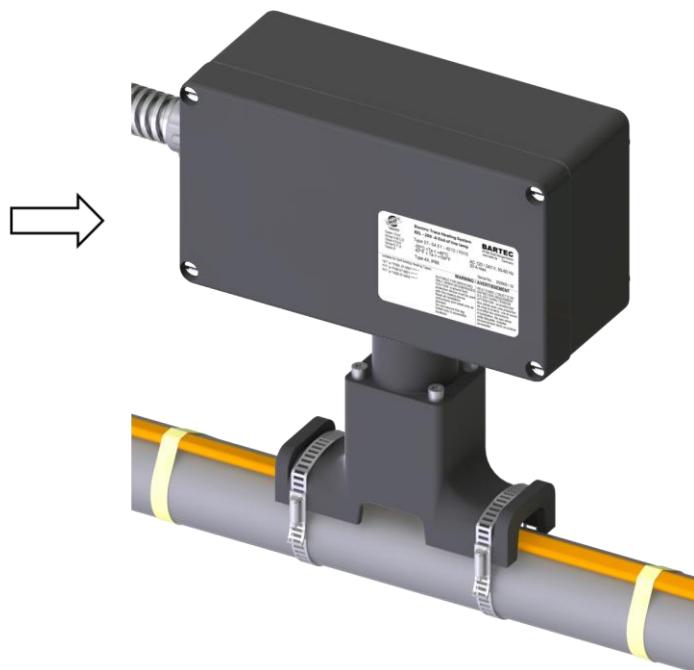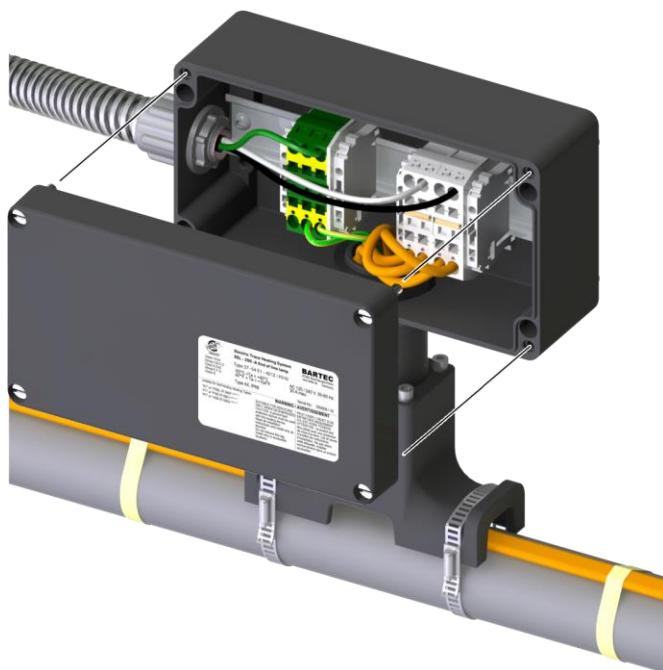

35


Installation of the end seal

- Cut the trace heater off straight.
- Remove 3/4" (20 mm) of the outer jacket.

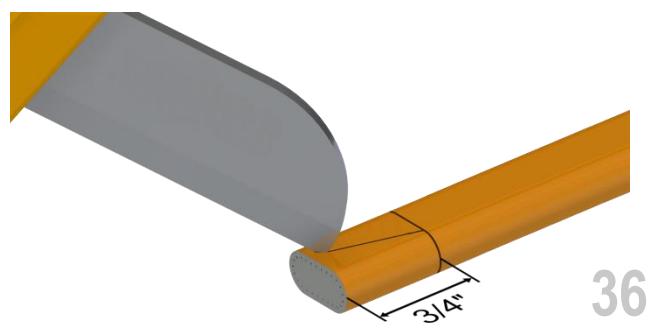


36

- Cut in a triangle (1/4" / 5 mm) between the bus wires.

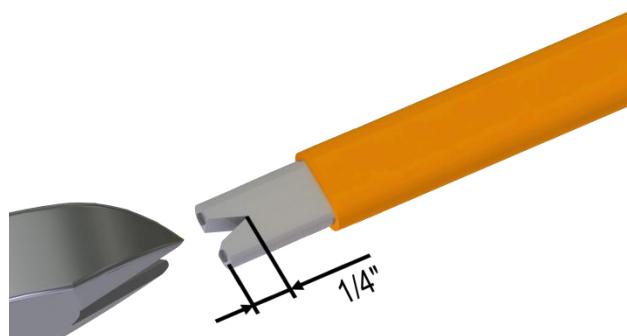

- Remove the exposed grounding braid. Make sure that the insulation jacket is not damaged.

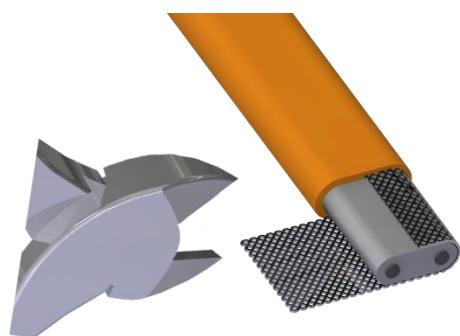

37

38

⚠ CAUTION

The silicone adhesive may cause irritation to skin and eyes. Avoid eye contact. Avoid repeated or prolonged skin contact. In case of contact with eyes, rinse with water and seek medical advice.

⚠ ATTENTION

La colle silicone peut irriter la peau et les yeux. Eviter tout contact avec les yeux. Eviter tout contact répété ou prolongé avec la peau. En cas de contact avec les yeux, rincer à l'eau claire et consulter un médecin.

- Put silicone adhesive onto the exposed insulating jacket and into the end seal.



39

- Slide the end seal over the end of the trace heater.



NOTICE

Allow the adhesive to cure for 20 minutes, then visually inspect. Full strength is reached after 24 hours.


AVIS

Laissez sécher la colle 20 minutes avant de procéder à une inspection visuelle. La résistance finale sera atteinte après 24 heures.

40

Application of the pipe insulation

- Apply the pipe insulation according to the manufacturer's installation instructions.
- Apply an electrical warning label every 10 ft. (3 m) on a clearly visible place.

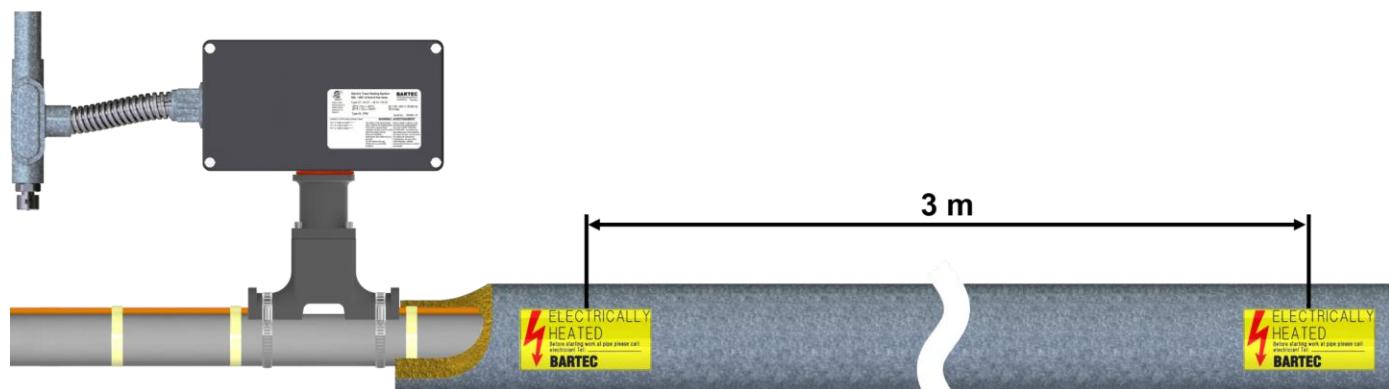

41

Troubleshooting

| Problem | Possible cause | Remedy |
|---|---|--|
| Trace heater remains cold | No power supply Trace heater bus wires or power wiring not properly connected Control unit adjusted incorrectly | Check the power wiring for continuity to circuit breaker. Connect the trace heater and power wires according to the installation instructions. Adjust the control unit according to the installation instructions. |
| Automatic circuit breaker tripped | Automatic circuit breaker defective Automatic circuit breaker has wrong tripping characteristics, e. g. "B" instead of "C" Nominal circuit breaker size is insufficient Maximum heating circuit length has been exceeded End seal has not been installed Short circuit Humidity inside the connection system or end seal | Replace the automatic circuit breaker. Install an automatic circuit breaker with Type-C tripping characteristics or contact the factory for Type-B tripping characteristics. Install an automatic circuit breaker with higher capacity. Observe the maximum amperage of all components of the trace heating circuit. Split the heating circuit into separate circuits. Install the end seal according to the installation instructions. Identify the cause and remedy the fault (e. g. ensure that trace heater bus wires are not twisted together). Dry the components. For junction boxes, be sure that the conduit drain is installed and breathing properly. |
| Ground fault protection is disengaged | Trace heater damaged Moisture in the components Ground fault protection defective | Replace the trace heater at the point where it is damaged. Dry the components. For junction boxes, be sure that the conduit drain is installed and breathing properly. Replace the ground fault protection device(s). |
| Low or inconsistent insulation resistance | Trace heater damaged Moisture in the components Arcing due to damaged trace heater insulation Arcing due to inadequate stripping distance between heating element and grounding braid Short-circuit between the grounding braid and the heating element or the grounding braid and the pipe Test leads touching the junction box | Replace the trace heater at the point where it is damaged. Dry the components. For junction boxes, be sure that the conduit drain is installed and breathing properly. Replace the trace heater at the point where it is damaged. Check the stripping distance between bus wires/heating element and grounding braid at all power, splice and end seal connections to ensure adequate separation. Check for cut or damaged cable or inadequate stripping length. Relocate test leads and retest. |

Note: High pipe temperature may lower the insulation resistance reading relative to earlier readings on a cold pipe.

Limited Product warranty**Scope**

BARTEC warrants that all BARTEC products and accessories that are the subject of this manual will be free from defects in materials and workmanship from and after its date of purchase for a period of 12 (twelve) months.

For the avoidance of doubt, this limited product warranty will not cover any damage caused by:

- accidents,
- misuse, improper installation, operation, maintenance or repairs,
- neglect, or
- alteration.

Furthermore, BARTEC cannot be held liable under this warranty for:

- installation or removal costs,
- loss or damage to property,
- indirect, special, incidental or consequential damages (including, without limitation, loss of revenue or anticipated profits), or
- any other damages or costs directly or indirectly related to the warranty issue.

If all warranty conditions are met (as set forth below), BARTEC will, at its sole discretion:

- repair the product,
- replace the product, or
- refund the purchase price paid for the product.

This warranty gives you specific legal rights, and you may also have other rights which vary by country, state or province. Except as specifically provided otherwise in this limited product warranty, the BARTEC Group General Terms and Conditions shall apply.

General terms and conditions

BARTEC Global Terms and conditions are available at: <https://www.bartec.de/en/terms/>

Conditions

The limited product warranty is subject to the following conditions:

- proper installation, operation and maintenance in compliance with the state of the technology and the product documentation, and
- presence of completely filled in acceptance reports for all installation, maintenance and repairwork operations.

How to claim the warranty

To file a claim under the limited product warranty:

- Notify BARTEC or your local BARTEC representative by written correspondence or email within 30 days after identification of a possible warranty issue.
- If requested, you must provide any warranty-related information and documentation to BARTEC, including, without limitation:
 - project planning documents, and
 - acceptance reports for installation, operation, maintenance or repairwork.

BARTEC GmbH
Max-Eyth-Straße 16
97980 Bad Mergentheim
Germany

Phone: +49 7931 597-0
Fax: +49 7931 597-499
info@bartec.com
www.bartec.com

BARTEC US
650 Century Plaza Drive, Suite D120
Houston, Texas 77073
USA

Phone: +1 281 214-8542
Fax: +1 281 214-8547
sales@bartec.us
www.bartec.us