



FLOOR WARNER

Floor warming cable installation test unit.


DESCRIPTION

The test unit will give an audible alarm if the conductor is broken or cut, and will alarm if the cable is pinched or crushed.

With the test unit installed rest assured your floor warming cable is intact during the course of your floor construction.


Remember to never use the Floor Warner with power attached to the heating cable. Always make sure the batteries are good.

Please call Delta-Therm at 1-800-526-7887 if you have any questions.

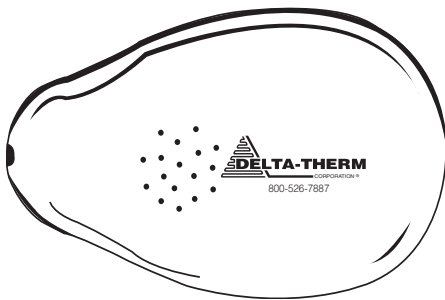

FLOOR WARNER INSTRUCTIONS

1. Install the floor warming cable per the cable installation instructions. Follow all cable testing procedures as described in the cable instructions.
2. The power connection wires from the floor warming cable should be sticking out of a junction box. Prepare the power connection wire ends for termination per instructions. Do not connect electrical power, thermostat or other device to the power connection wires.
3. Momentarily switch on the Floor Warner to ensure the alarm will sound.
4. Attach the ground braid from the floor warming cable to the Floor Warner terminal with the green wire leading to the other side of the terminal.
5. Connect the inner conductor of one of the floor warming cable lead wires to the terminal with the black lead wire connected to the other side of the terminal.
6. Connect the inner conductor of the other floor warming lead wire to the terminal with the red lead wire connected to the other side of the terminal.
7. Turn the Floor Warner slide action switch to the ON position, the test unit should be silent.
8. Use a jumper wire to touch the terminal screw of the green/ground braid terminal to the terminal screw of the red/floor cable (see illustration). The Floor Warner's audible alarm should sound.
9. With the Floor Warner switched ON, remove the floor warming cable inner conductor from the terminal with the red/floor cable. The audible alarm should sound. Reconnect the wire and the alarm should stop.

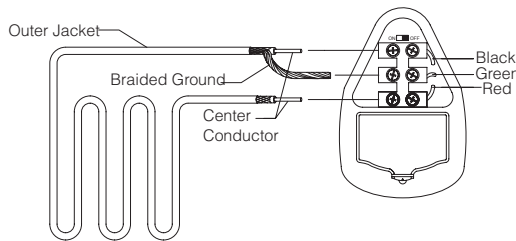

Detail 1.



CAUTION: Hazard of electric shock. Disconnect all power before starting. All installations must be grounded to earth to eliminate shock hazards.



398 W. Liberty St. P.O. Box 345 Wauconda, IL 60084
(800) 526-7887 (847) 526-2407 (312) 346-0053 FAX (847) 526-4456
Email heat@delta-therm.com Internet <http://www.delta-therm.com>

